

## Two Day (48 hour) Radon Test Results

### Customer Information

Name: Mr & Mrs Sample  
 Contact info: sample@sample.com

### Inspector Information

Brian Henley  
 Keystone Home & Environmental Services, LLC  
 Haymarket, VA 20168  
 571-238-5201  
 Lic. #: 105470RMP  
 Lic Exp: 7/31/2027

### Testing Site Information

Street Address: 1234 Sample Rd  
 City,State, Zip: Fairfax, VA 22032  
 Structure Type: Walk Out Basement  
 Monitor Location: Finished walkout basement  
 Home Occupied: Yes  
 Weather: Clear, 50's-80's  
 Mitigation System: No

### Continuous Radon Monitor (CRM)

Model: Sun Nuclear 1028XP  
 Unit #: 6  
 Serial #: 300003486  
 Calibration: 6/14/2025

### Test Summary

Monitor Placed: 8/27/25 9:14 AM  
 Start Time: 8/27/2025 10:14  
 End Time: 8/29/2025 9:14  
 Measurement Interval: hourly  
 Closed House Conditions maintained: Yes  
 Non-Interference agreement signed: No  
 Is Test part of a Real Estate Transaction: Yes

Test Results		
EPA Average:	9.7	pCi/L


EPA Action level is 4.0 pCi/L or higher

### Recommendations:

Action is needed to reduce the radon levels within the home. Consult a licensed radon mitigation specialist.

For more information, please visit [www.epa.gov/radon](http://www.epa.gov/radon)

NOTES: The first four measurements are discarded from the calculation of the average to allow for equilibration of the CRM equipment (per ANSI/ARST).

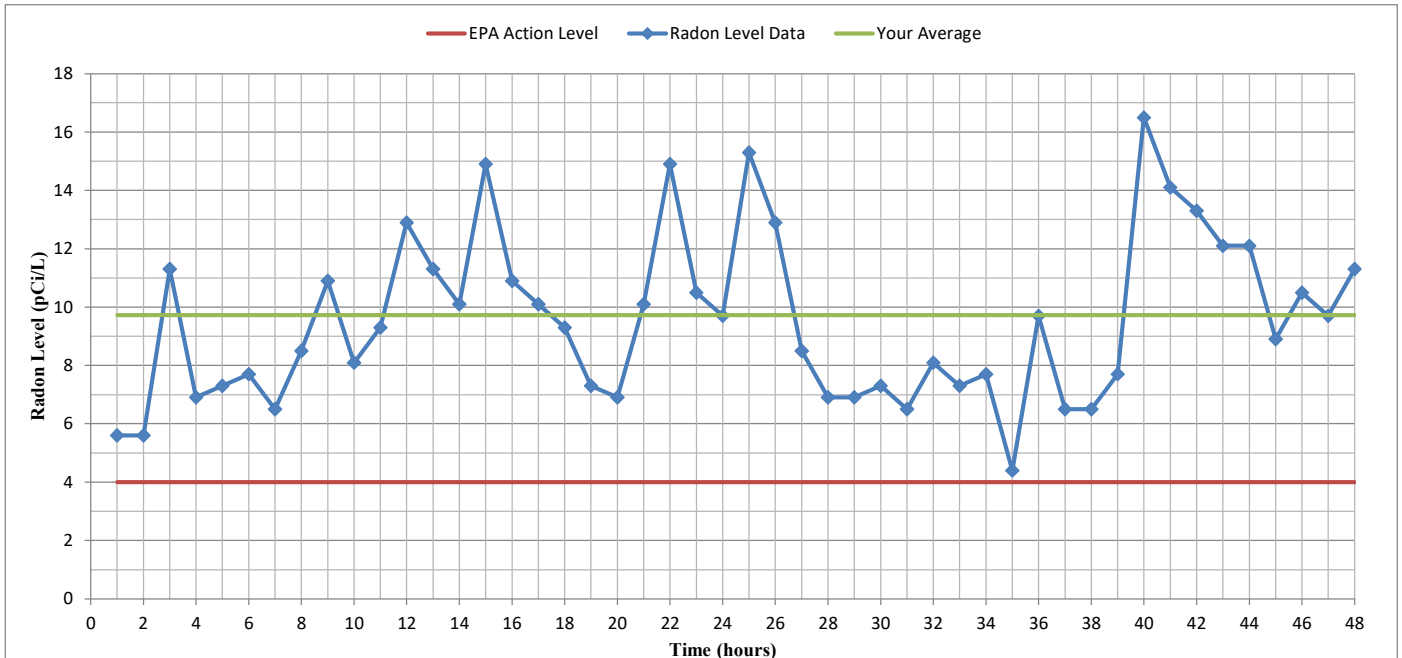

Keystone Home and Environmental Services, LLC

**RAW DATA:**

M = motion detected

Date/Time	pCi/l	Temp(F)	Pres(inHg)	Humidity(%)	Flags
8/27/2025 10:14	5.6	-	-	-	-
8/27/2025 11:14	5.6	-	-	-	-
8/27/2025 12:14	11.3	-	-	-	-
8/27/2025 13:14	6.9	-	-	-	-
8/27/2025 14:14	7.3	-	-	-	-
8/27/2025 15:14	7.7	-	-	-	-
8/27/2025 16:14	6.5	-	-	-	-
8/27/2025 17:14	8.5	-	-	-	-
8/27/2025 18:14	10.9	-	-	-	-
8/27/2025 19:14	8.1	-	-	-	-
8/27/2025 20:14	9.3	-	-	-	-
8/27/2025 21:14	12.9	-	-	-	-
8/27/2025 22:14	11.3	-	-	-	-
8/27/2025 23:14	10.1	-	-	-	-
8/28/2025 0:14	14.9	-	-	-	-
8/28/2025 1:14	10.9	-	-	-	-
8/28/2025 2:14	10.1	-	-	-	-
8/28/2025 3:14	9.3	-	-	-	-
8/28/2025 4:14	7.3	-	-	-	-
8/28/2025 5:14	6.9	-	-	-	-
8/28/2025 6:14	10.1	-	-	-	-
8/28/2025 7:14	14.9	-	-	-	-
8/28/2025 8:14	10.5	-	-	-	-
8/28/2025 9:14	9.7	-	-	-	-
8/28/2025 10:14	15.3	-	-	-	-
8/28/2025 11:14	12.9	-	-	-	-
8/28/2025 12:14	8.5	-	-	-	-
8/28/2025 13:14	6.9	-	-	-	-
8/28/2025 14:14	6.9	-	-	-	-
8/28/2025 15:14	7.3	-	-	-	-
8/28/2025 16:14	6.5	-	-	-	-
8/28/2025 17:14	8.1	-	-	-	-
8/28/2025 18:14	7.3	-	-	-	-
8/28/2025 19:14	7.7	-	-	-	-
8/28/2025 20:14	4.4	-	-	-	-
8/28/2025 21:14	9.7	-	-	-	-
8/28/2025 22:14	6.5	-	-	-	-
8/28/2025 23:14	6.5	-	-	-	-
8/29/2025 0:14	7.7	-	-	-	-
8/29/2025 1:14	16.5	-	-	-	-
8/29/2025 2:14	14.1	-	-	-	-
8/29/2025 3:14	13.3	-	-	-	-
8/29/2025 4:14	12.1	-	-	-	-
8/29/2025 5:14	12.1	-	-	-	-
8/29/2025 6:14	8.9	-	-	-	-
8/29/2025 7:14	10.5	-	-	-	-
8/29/2025 8:14	9.7	-	-	-	-
8/29/2025 9:14	11.3	-	-	-	-

not used  
not used  
not used  
not used